
Connector Terminal Boxes

CSM_XW3D_DS_E_3_2

Simple Wiring of Sensor Actuators

- Greatly reduce wiring in combination with the Smartclick XS5.
- Insert the connector and turn 1/8 of a turn to lock the connectors.
- Higher rated current to enable output applications.
- Use previous M12 screw connectors.

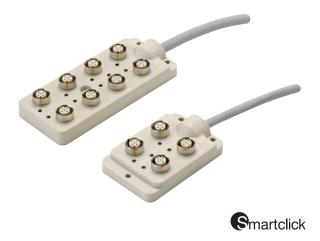

Specifications

Rated current	4 A/port, 12 A/Box (power line)		
Rated voltage	10 to 30 VDC		
Contact resistance	40 mΩ max.		
(connector)	(20 mV max., 100 mA max.)		
Insulation resistance	1,000 MΩ min. (at 500 VDC)		
Dielectric strength	500 VAC for 1 min		
(connector)	(leakage current: 1 mA max.)		
Degree of protection	IP67 (IEC60529)		
Insertion tolerance	50 times min.		
Lock strength	Pulling: 100 N/15 s, Twisting: 1 N·m/15 s		
Cable holding strength	100 N/15 s		
Lock operating force	0.1 to 0.25 N·m		
Ambient temperature range	Operating: -25 to 70°C *		

*Use the robot cable within a temperature range between 0°C and 70°C to prevent the wires inside the cable from being broken when bending it.

Connection Combinations

OMRON model no.		Twist-and-Click Plug Connectors	M12 Plug Connectors	
		XS5H, XS5G, XS5W (plug end), XS5R (plug end)	XS2H, XS2G, XS2W (plug end), XS2R (plug end)	
Connector Terminal Box	XW3D	O	О	

○: Connected by Smartclick.

O: Connected by screwing.

Smartclick is a registered trademark of the OMRON Corporation.

Item	Materials/finish		
Contacts	Brass/nickel base, 0.4-µm gold-plating		
Fixtures	Nickel-plated zinc alloy		
Case	PBT resin (UL94V-O), light gray		
Bushing	Rubber		
O-ring	Rubber		
РСВ	Glass epoxy board		
Sealing resin	Urethane resin (UL94V-0)		
Oshla	UL AWM2464		
Cable	Signal lines: AWG22 Power and ground lines: AWG18		

Materials and Finish

Ordering Information

Sensor type	e and wiring	3-wire DC NPN/2-wire DC 3-4	3-wire DC PNP/2-wire DC 1-4	
Actuato	or wiring	Actuator wiring 1-4 —		Actuator wiring 3-4
No. of ports	No. of I/O	Model		
4	4	XW3D-P455-G11	XW3D-P452-G11	XW3D-P453-G11
8	8	XW3D-P855-G11	XW3D-P852-G11	XW3D-P853-G11
4	8	XW3D-P458-G11	_	XW3D-P457-G11


Note 1. "1-4" and "3-4" are the connector pin numbers that are wired. 2. All cables are 5 m long.


Waterproof Cover (Sold Separately)

Appearance Model		No. per box	Material	
	XS5Z-11	50	PBT	
	XS2Z-22	50	Brass with Ni plating	

Note 1. The XW3D/XW3B/XW3A comes with a dust cover. If IP67 degree of protection is required, use the XS5Z-11 or XS2Z-22 (sold separately). 2. The XS2Z-22 connection is threaded.

Dimensions

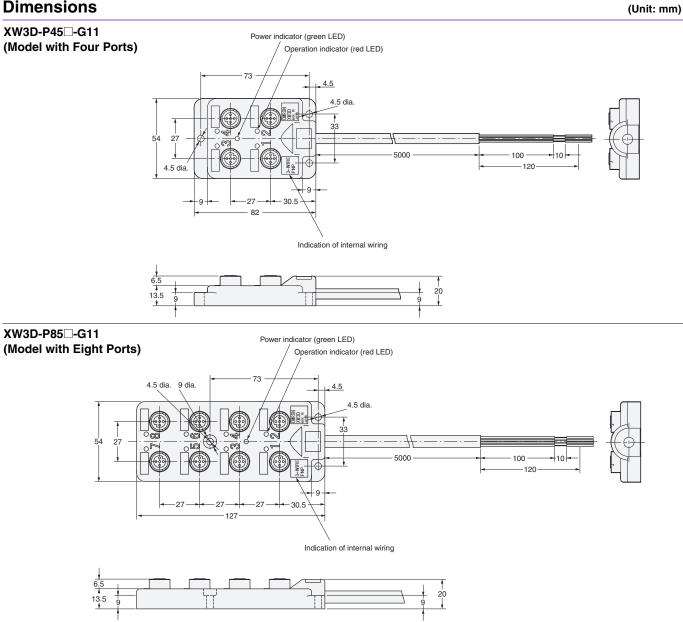

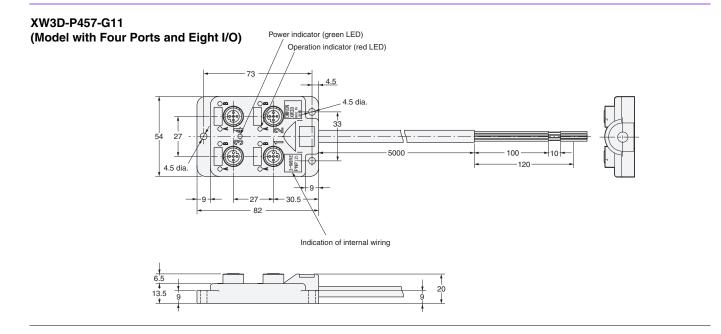

Wiring Diagrams

Models with One I/O and One Port


XW3D-P 55- 11 for 3-wire NPN, 2-wire DC (without polarity 3-4), and Actuator (1-4)

Posi	tive	Nega			
power : (Bro	supply	power s	supply		around
e			Ð	Connector pin number	
	<u>₹</u>	vv—	4	/	
Signal 1 ()- (White)		, <u> </u>		<u>)</u>	
Lead color	Operation indica	ator (red LED)		>	
Signal 2 ② (Green)	- N	~ _		<u>)</u>	
Signal 3 (3)	<u>শ</u>	~		Ì	
Signal 4 (4)	्र स्	~		Ì	
Signal 5 ⑤– (Pink)	শ্	~		0	
Signal 6 6 (Red)	শ	~ _		Ì	
Signal 7 (7)	শ্	~		Ì	
Signal 8 (8)	<u>ب</u>	~		Ì	


XW3D-P 52-11 for 2-wire DC

(polarity 1-4, without polarity 3-4) Note: Cannot be used with NPN-type Photoelectric and Proximity Sensors. Cannot be used with Proximity Sensors with polarity 3-4.

2-WIRE

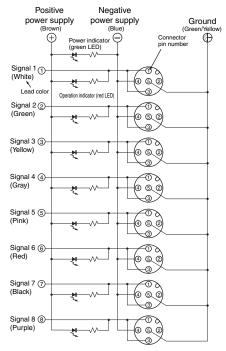

XW3D-PD53-D11 for 3-wire PNP, 2-wire DC (with polarity 1-4), and Actuator (3-4)

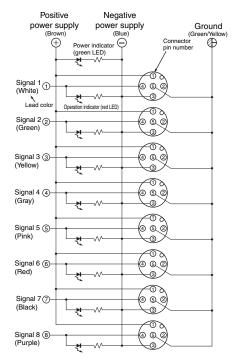

Note 1. The above wiring diagrams are for eight-port use.

2. Figures in parentheses indicate lead colors.

3. The expression "white/red" means white and red stripes.


4. Here, "1-4" and "3-4" are pin numbers.

5. Contact numbers 5 through 8 in the above diagrams do not exist on Terminal Boxes with four ports. The lead colors for signals 1 through 4, power supply, and ground are the same.

XW3D


Models with Two I/O and One Port

XW3D-P458-G11

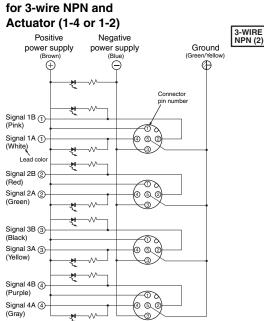

Note: Colors given in the connection diagram are lead colors.

Mounting Dimensions

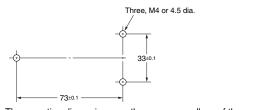

Note: The mounting dimensions are the same regardless of the number of ports.


Safety Precautions

Precautions for Correct Use

Do not use the Connectors in an atmosphere or environment that exceeds the specifications.

Connector Connection and Disconnection

- Mate the connectors according to the procedure.
- When mating Connectors, be sure to insert the plug all the way to the back of the socket before attempting to lock the Connectors.
- Do not use tools of any sort to mate the Connectors. Always use your hands. Pliers or other tools may damage the Connectors.
- When mating the Connectors to XS2 or other M12 Connectors, tighten the lock by hand to a torque of 0.39 to 0.49 N·m.
- Confirm in the catalog that sensors and actuators are applicable before using them.
- Always turn OFF the power supply before connecting or disconnecting connectors.
- Do not touch the mating surface of the connectors with wet hands.
- Wipe away any water around the connectors.
- Do not allow metal scraps or dust to enter the mating section.

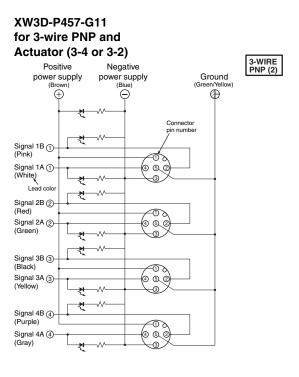

(Unit: mm)

Cable Lead Polarity

- Connect the cables leads using the correct polarity (Blue: Negative power supply, Brown: Positive power supply).
- If the polarity is not correct, the load may not operate or the operation indicator may not light.
- Always connect a load to the signal lines to operate a sensor or actuator.

Applicable Connectors

 Always mount a Waterproof Cover (XS2Z-22) or Dust Cover (XS2Z-15) to any unused connector on the Connector Terminal Box.

Power Supply and Operation Indicators

- The power supply indicator will be lit green while power is being supplied. The operation indicator will be lit red while the sensor or actuator is operating.
- The XW3D is for a DC sensor or actuator. Do not use it for an AC sensor or actuator.
- Connector Terminal Boxes are available with either 2-wire or 3-wire internal connections, as indicated on the case.



OMRON

Read and understand this catalog.

Please read and understand this catalog before purchasing the products. Please consult your OMRON representative if you have any questions or comments.

Warranties.

(a) Exclusive Warranty. Omron's exclusive warranty is that the Products will be free from defects in materials and workmanship for a period of twelve months from the date of sale by Omron (or such other period expressed in writing by Omron). Omron disclaims all other warranties, express or implied.

(b) Limitations. OMRON MAKES NO WARRANTY OR REPRESENTATION, EXPRESS OR IMPLIED, ABOUT NON-INFRINGEMENT, MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OF THE PRODUCTS. BUYER ACKNOWLEDGES THAT IT ALONE HAS DETERMINED THAT THE

PRODUCTS WILL SUITABLY MEET THE REQUIREMENTS OF THEIR INTENDED USE.

Omron further disclaims all warranties and responsibility of any type for claims or expenses based on infringement by the Products or otherwise of any intellectual property right. (c) Buyer Remedy. Omron's sole obligation hereunder shall be, at Omron's election, to (i) replace (in the form originally shipped with Buyer responsible for labor charges for removal or replacement thereof) the non-complying Product, (ii) repair the non-complying Product, or (iii) repay or credit Buyer an amount equal to the purchase price of the non-complying Product; provided that in no event shall Omron be responsible for warranty, repair, indemnity or any other claims or expenses regarding the Products unless Omron's analysis confirms that the Products were properly handled, stored, installed and maintained and not subject to contamination, abuse, misuse or inappropriate modification. Return of any Products by Buyer must be approved in writing by Omron before shipment. Omron Companies shall not be liable for the suitability or unsuitability or the results from the use of Products in combination with any electrical or electronic components, circuits, system assemblies or any other materials or substances or environments. Any advice, recommendations or information given orally or in writing, are not to be construed as an amendment or addition to the above warranty.

See http://www.omron.com/global/ or contact your Omron representative for published information.

Limitation on Liability; Etc.

OMRON COMPANIES SHALL NOT BE LIABLE FOR SPECIAL, INDIRECT, INCIDENTAL, OR CONSEQUENTIAL DAMAGES, LOSS OF PROFITS OR PRODUCTION OR COMMERCIAL LOSS IN ANY WAY CONNECTED WITH THE PRODUCTS, WHETHER SUCH CLAIM IS BASED IN CONTRACT, WARRANTY, NEGLIGENCE OR STRICT LIABILITY.

Further, in no event shall liability of Omron Companies exceed the individual price of the Product on which liability is asserted.

Suitability of Use.

Omron Companies shall not be responsible for conformity with any standards, codes or regulations which apply to the combination of the Product in the Buyer's application or use of the Product. At Buyer's request, Omron will provide applicable third party certification documents identifying ratings and limitations of use which apply to the Product. This information by itself is not sufficient for a complete determination of the suitability of the Product in combination with the end product, machine, system, or other application or use. Buyer shall be solely responsible for determining appropriateness of the particular Product with respect to Buyer's application, product or system. Buyer shall take application responsibility in all cases.

NEVER USE THE PRODUCT FOR AN APPLICATION INVOLVING SERIOUS RISK TO LIFE OR PROPERTY OR IN LARGE QUANTITIES WITHOUT ENSURING THAT THE SYSTEM AS A WHOLE HAS BEEN DESIGNED TO ADDRESS THE RISKS, AND THAT THE OMRON PRODUCT(S) IS PROPERLY RATED AND INSTALLED FOR THE INTENDED USE WITHIN THE OVERALL EQUIPMENT OR SYSTEM.

Programmable Products.

Omron Companies shall not be responsible for the user's programming of a programmable Product, or any consequence thereof.

Performance Data.

Data presented in Omron Company websites, catalogs and other materials is provided as a guide for the user in determining suitability and does not constitute a warranty. It may represent the result of Omron's test conditions, and the user must correlate it to actual application requirements. Actual performance is subject to the Omron's Warranty and Limitations of Liability.

Change in Specifications.

Product specifications and accessories may be changed at any time based on improvements and other reasons. It is our practice to change part numbers when published ratings or features are changed, or when significant construction changes are made. However, some specifications of the Product may be changed without any notice. When in doubt, special part numbers may be assigned to fix or establish key specifications for your application. Please consult with your Omron's representative at any time to confirm actual specifications of purchased Product.

Errors and Omissions. Information presented by Omron Companies has been checked and is believed to be accurate; however, no responsibility is assumed for clerical, typographical or proofreading errors or omissions.

In the interest of product improvement, specifications are subject to change without notice.

OMRON Corporation Industrial Automation Company